



3D Printing with **PANTONE®** Colors



Overview

All J8 Series™ printers, the J826™¹, J835™ and J850 printers are PANTONE Validated™. This is the first additive manufacturing technology that offers professional design realism. Pantone, a leading global authority on professional color standards in multiple vertical industries helps designers, modelers, and manufacturers all over the world accurately define, communicate, and consistently reproduce colors. Using a simple workflow, Stratasys CMYK colors can be matched to 1,970 printable Pantone Colors, Solid Coated and SkinTones™.

3D printing with Pantone reduces time and costs significantly and ensures superior color fidelity.

This document describes recommendations and tips for best color results when printing 3D parts with Pantone Colors on Stratasys printers.

- A. Supported Printers, Materials, and Modes
- B. Preparing for Printing
- C. Printing Parts with Pantone Colors

¹ Final validation is pending



3D Printing with PANTONE

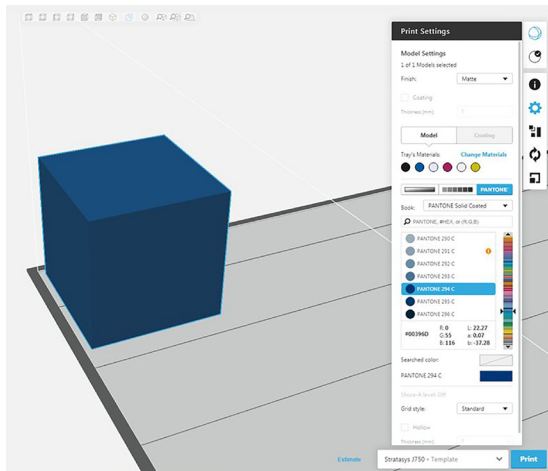


Figure 1: Pantone Color selection in GrabCAD Print

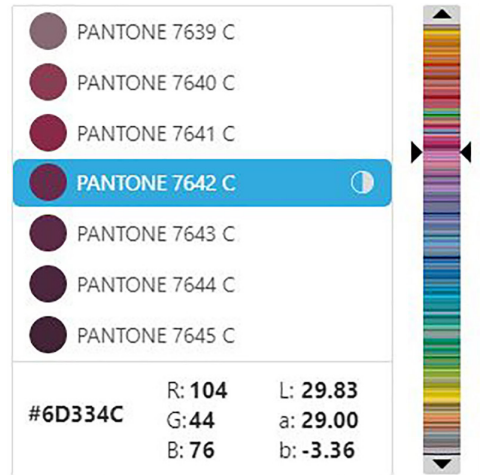


Figure 2: Pantone Colors with color simulation indicator (sample)

Recommendations and Tips

A. Supported Printers, Materials and Modes

3D Printers	J850 (software version 85.1.0.25247 D97.1 and above), J835 (software version 83.1.0.25248 D98.1 and above), J826 (validation available April 2020)
Printing Modes	High Mix, High Quality (High Speed is not supported.)
Model Materials	<ul style="list-style-type: none"> VeroVivid™ materials: VeroCyanV™, VeroMagentaV™, VeroYellowV™ Vero PureWhite™ VeroBlackPlus™
Support Materials	SUP705™, SUP706B™
All File Types	All file types that GrabCAD Print can import
Assignment Type	Color per shell
GrabCAD Print	GrabCAD Print™ version 1.34 and above (Note: The advanced slicer must be enabled.)

B. Preparing for Printing

Proper file preparation, printing material usage, and color selection and assignment are required for best results when printing Pantone Colors.

- Pantone Colors have been tested and validated for parts printed as follows:
 - a flat and glossy surface.
 - a 1-mm thick color coating over a 4-mm thick core made of Vero PureWhite.

Other geometries and thickness might result in color differences.

- It is recommended to use the Pantone PMS Color Guides for Solid Coated and SkinTone™ to identify the color you wish to 3D print.

Tip

Make sure that the guides are current and in good condition. Pantone recommends purchasing new guides annually, because the colors change over time.

3D Printing with PANTONE

- Use STL files. VRML files are not supported.
- In GrabCAD Print, the advanced slicer must be enabled to use the Pantone Colors.
- Pantone Colors are not suitable for printing on walls that are less than 3-mm thick.
- These five materials must be loaded in the material cabinet (see Figure 3):
 - Vero PureWhite
 - VeroBlackPlus
 - VeroCyanV
 - VeroMagentaV
 - VeroYellowV

The sixth material can be any material you choose (for example, VeroClear™, Agilus30™ White).

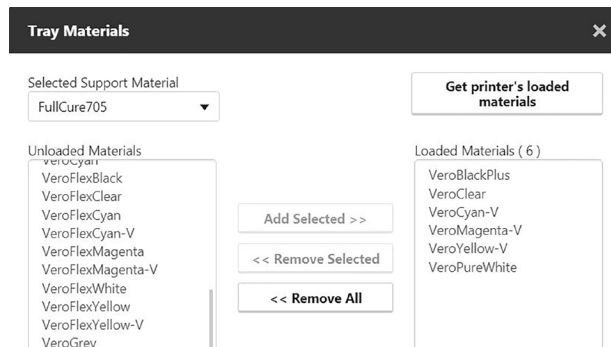






Figure 1: Loaded materials for printing with Pantone.

- When printing the Pantone Colors, the VeroVivid materials are opaque, due to the Vero PureWhite core. Transparency is not supported.
- Avoid switching materials to prevent color contamination that might adversely affect color accuracy. If you switched materials, perform two material replacement cycles to flush the system thoroughly and achieve the intended color accuracy.
- Printed colors may vary from the Pantone Colors due to several factors, such as temperature, materials, printer maintenance and calibration. The degree of color matching between the Pantone Color and the printed color is indicated in GrabCAD Print next to the Pantone Color.

Tip

With Pantone Colors, the color of the model on the build tray in GrabCAD Print will be the actual color of the printed model.

3D Printing with PANTONE

Indicator	Meaning
	Accurate match. Differences are generally minor and acceptable.
	Minor visible differences might be seen between the printed color and Pantone swatch. Acceptability will vary by job.
	Visible differences might be seen between the printed color and Pantone swatch. Acceptability will vary by job.
	Major visible difference might be seen between printed color and Pantone swatch. Acceptability will vary by job.

C. Printing Parts with Pantone Colors

1. Load the Model printing materials listed above.
2. Insert your part into GrabCAD Print.
3. Display the Print Settings dialog box and select PANTONE®.

Tip

If the Pantone button is disabled, you need to enable the advanced slicer in GrabCAD Print Preferences.

3D Printing with PANTONE



Figure 5: Selecting Pantone Colors in GrabCAD Print.

- From the Book drop-down list, select the **Pantone Solid Coated** or **SkinTone™** guide.

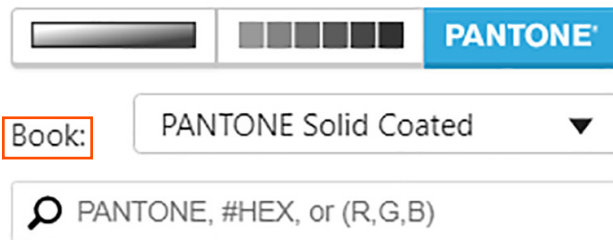


Figure 6: Selecting the Pantone guide.

- In the search box, enter the Pantone Color value you wish to print. Alternatively, you can select from the list of colors or enter the equivalent Hex or RGB values for the color you wish to print.

Tip

When entering an RGB value, write it inside parentheses. For example (68, 161, 210).

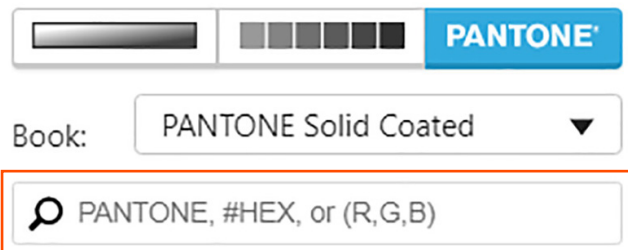


Figure 7: Search box for entering a color value.

3D Printing with PANTONE

A range of Pantone Colors appear.

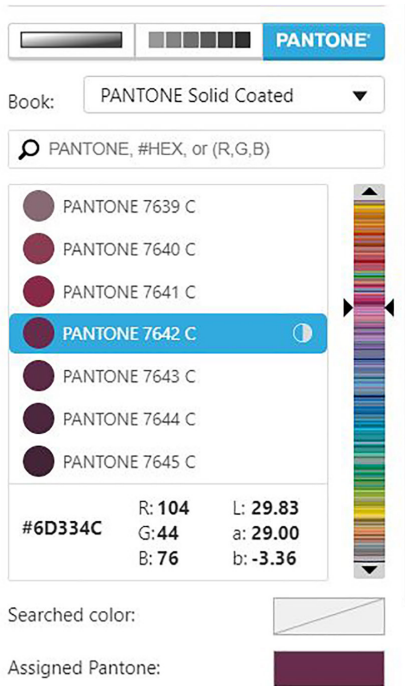


Figure 8: Pantone Colors with color simulation indicator showing.

6. Assign the selected Pantone Colors to the part and print.

Stratasys Headquarters

7665 Commerce Way,
Eden Prairie, MN 55344
+1 800 801 6491 (US Toll Free)
+1 952 937-3000 (Intl)
+1 952 937-0070 (Fax)

stratasys.com
ISO 9001:2015 Certified

1 Holtzman St., Science Park,
PO Box 2496
Rehovot 76124, Israel
+972 74 745 4000
+972 74 745 5000 (Fax)

© 2020 Stratasys Ltd. All rights reserved. Stratasys, PolyJet, J826, J835, J850, VeroClear, VeroVivid, VeroMagentaV, VeroCyanV, VeroYellowV, VeroPureWhite, VeroBlackPlus, SUP705, SUP706B, and GrabCAD Print are trademarks of Stratasys Ltd. and/or its subsidiaries or affiliates and may be registered in certain jurisdictions. PANTONE® and all other Pantone trademarks are the property of Pantone LLC. Used with permission of Pantone LLC, under license agreement with Stratasys Ltd. All other product names and trademarks are the property of their respective owners. BP_PJ_3DPrintingWithPantone_0120a

Disclaimer: Customer acknowledges the contents of this document and that Stratasys parts, materials, and supplies are subject to its standard terms and conditions, available on <http://www.stratasys.com/legal/terms-and-conditions-of-sale>, which are incorporated herein by reference.

